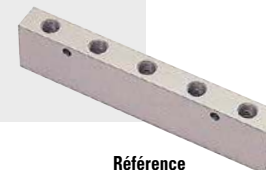
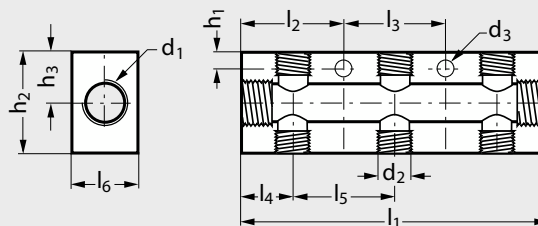


# Nourrice de distribution double taraudée


**MATIÈRE**

- Aluminium anodisé.

**UTILISATION**

- Pression maxi : 20 bars.  
- Température d'utilisation :  
-10°C à +80°C.

**Référence**

■ Exemple de commande **H322-1/4-1/8-4**

	d <sub>1</sub>	d <sub>2</sub>	d <sub>3</sub>	l <sub>1</sub>	l <sub>2</sub>	l <sub>3</sub>	l <sub>4</sub>	l <sub>5</sub>	l <sub>6</sub>	h <sub>1</sub>	h <sub>2</sub>	h <sub>3</sub>	Nb de sorties
H322-1/4-1/8-4	1/4"	1/8"	5	61	5,5	50	15,5	30	20	4,5	30	15	2x2
H322-1/4-1/8-6	1/4"	1/8"	5	91	30,5	30	15,5	30	20	4,5	30	15	2x3
H322-1/4-1/8-8	1/4"	1/8"	5	121	30,5	60	15,5	30	20	4,5	30	15	2x4
H322-1/4-1/8-10	1/4"	1/8"	5	151	30,5	90	15,5	30	20	4,5	30	15	2x5
H322-3/8-1/4-4	3/8"	1/4"	6,5	74	6,5	61	19	36	20	6	40	20	2x2
H322-3/8-1/4-6	3/8"	1/4"	6,5	110	37	36	19	36	20	6	40	20	2x3
H322-3/8-1/4-8	3/8"	1/4"	6,5	146	37	72	19	36	20	6	40	20	2x4
H322-3/8-1/4-10	3/8"	1/4"	6,5	182	37	108	19	36	20	6	40	20	2x5
H322-1/2-1/4-6	1/2"	1/4"	6,5	116	40	36	22	36	28	6	40	20	2x3
H322-1/2-1/4-8	1/2"	1/4"	6,5	152	40	72	22	36	28	6	40	20	2x4
H322-1/2-1/4-10	1/2"	1/4"	6,5	188	40	108	22	36	28	6	40	20	2x5